





Front Camera Calibration

Mazda






Model	Year	Setup
2 [DJ]	Front driver assistance camera H8.1	2
6 [GJ]	Front driver assistance camera H8.1	2
BT-50 [TF]	Front driver assistance camera 1.0	3
CX 3 [DK]	Front driver assistance camera D4.0	1
CX 3 [DK]	Front driver assistance camera H8.1	2
CX 30 [DM]	Front driver assistance camera H8.2	2
CX 5 [KE]	Front driver assistance camera D4.0	1
CX 5 [KF]	Front driver assistance camera H8.1	2
CX 8 [KG]	Front driver assistance camera H8.1	2
CX 9 [TB]+[TC]	Front driver assistance camera D4.0	1
Demio [DJ]	Front driver assistance camera D4.0	1
Demio [DJ]	Front driver assistance camera H8.1	2
CX 9 [TC]	Front driver assistance camera H8.1	2
MX 5 [ND]	Front driver assistance camera D4.0	1
MX 5 [ND]	Front driver assistance camera H8.1	2
MX 30 [DR]	Front driver assistance camera H8.2	2

Model	Year	Setup
Roadster [ND]	Front driver assistance camera D4.0	1
Serie-2 [DJ, DL]	Front driver assistance camera D4.0	1
Serie-3 [BM]	Front driver assistance camera D4.0	1
Serie-3 [BP,BN]	Front driver assistance camera H8.1	2
Serie-6 [GJ]	Front driver assistance camera D4.0	1
Serie-6 [GL]	Front driver assistance camera H8.1	2

Typ	Target	Part-No.	
1	CTA 209-1	1 688 130 318 (1 690 382 318)	
2	CTA 208-1	1 688 130 429 (1 690 382 429)	
3	CTA 302-1	1 688 130 468	

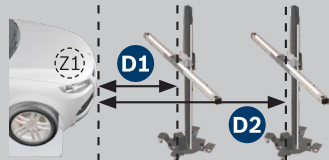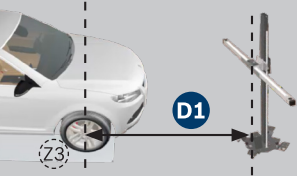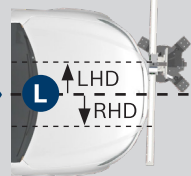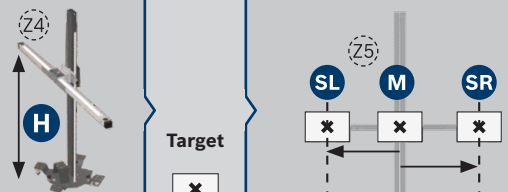		1. (D1) / 6. (D2)					2.	3.	4.	5.		
Setup	Process											
		D1	D2	D1	D2	D1	L	H	Target			
												
1	1-5	500 mm	-	-	-	-	0	1270 mm	1	M	-	-
2	1-5	1600 mm	-	-	-	-	0	1400 mm	2 (2x)	SL + SR	1000 mm	1000 mm
3	1-5	4113 mm	-	-	-	-	0	1060 mm	3	M	-	-

 Zoom (see page 2), **LHD** – Left Hand Drive, **RHD** – Right Hand Drive

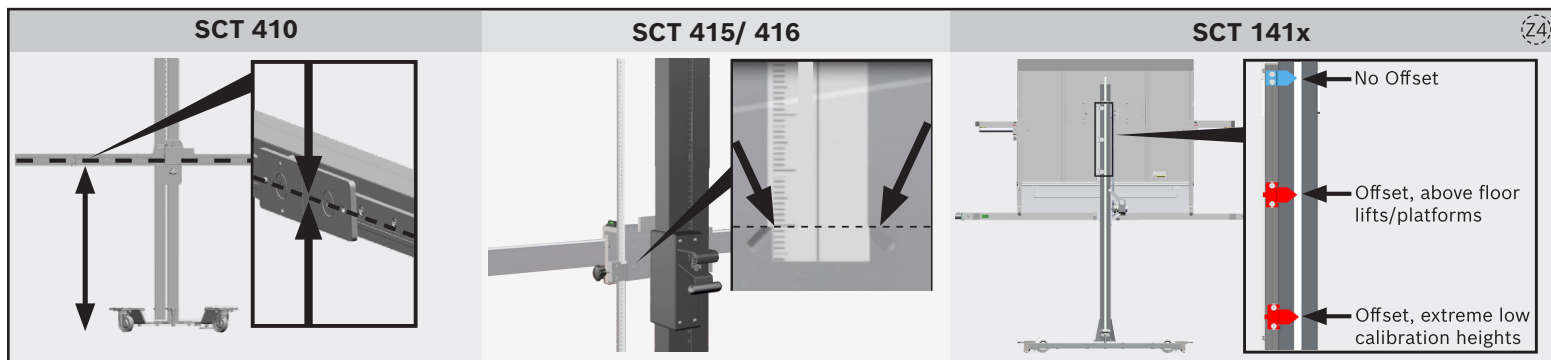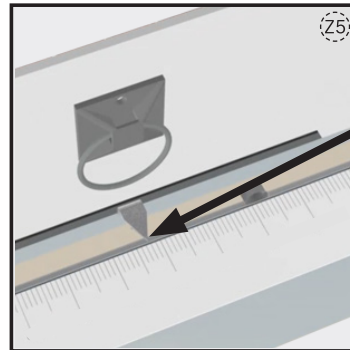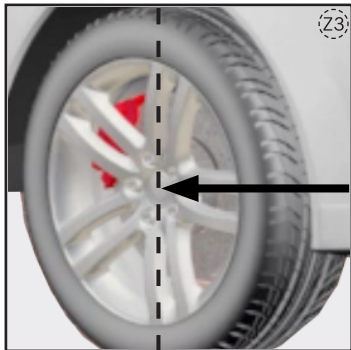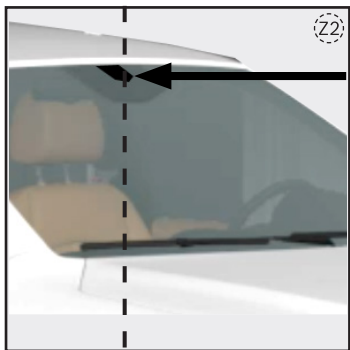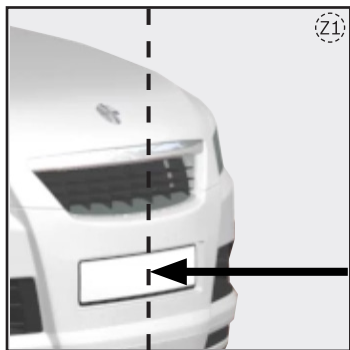

ADAS Help Center

Robert Bosch GmbH
Automotive Service Solutions
Franz-Oechsle-Straße 4
73207 Plochingen
DEUTSCHLAND
bosch.prueftechnik@bosch.com



www.boschaftermarket.com



www.downloads.bosch-automotive.com